

-CHANGED OIL AND OIL FILTERS -CHANGED FUEL FILTERS -CHECKED PRIMARY AIR FILTER ELEMENT AND REPLACED IF NEEDED -CHANGED AIR FILTER PRECLEANERS -CHECKED COOLING SYSTEM -CHECKED LUBE OIL SYSTEM	
-CHECKED PRIMARY AIR FILTER ELEMENT AND REPLACED IF NEEDED -CHANGED AIR FILTER PRECLEANERS -CHECKED COOLING SYSTEM -CHECKED LUBE OIL SYSTEM	
REPLACED IF NEEDED -CHANGED AIR FILTER PRECLEANERS -CHECKED COOLING SYSTEM -CHECKED LUBE OIL SYSTEM	
-CHANGED AIR FILTER PRECLEANERS -CHECKED COOLING SYSTEM -CHECKED LUBE OIL SYSTEM	
-CHECKED COOLING SYSTEM -CHECKED LUBE OIL SYSTEM	
-CHECKED LUBE OIL SYSTEM	
-CHECKED FUEL SYSTEM	
-CHECKED AIR SYSTEM	
-CHECKED EXHAUST SYSTEM	
-CHECKED STARTING SYSTEM	
-CHECKED BATTERIES AND CLEANED AS NEEDED	
-CHECKED ENGINE MONITORS AND SAFETY CONTROLS	
-CHECKED CONTROL PANEL	
-RAN ENGINE AND CHECKED FOR PROPER OPERATION	
-TOOK OIL SAMPLE ONLY AS PER SERVICE REQUEST.	

COMMENTS/RECOMMENDATIONS: NO PROBLEMS CURREN	NTI Y
DETECTED.	
WO Total:	1,190.00
1484550 Aug 04, 2006 12:00 AM 7084 EM99252 - 00 C 056 7002 440.00 TRAVEL.	-,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,,
SEGMENT COVERS TRAVEL TIME. MILEAGE AND ASSOCIAT	TED
TOLLS TO AND FROM JOBSITE.	ILD
EM99252 - 01 C 023 1350 560.20 WATER LEAK ABOVE THROTTLE PLATE	
8/9 ARRIVED AND GAINED ACCESS TO GEN ROOM.	
REMOVED WATER TRAP FROM ENGINE AND ALL LINES	
TO IT. CHECKED LINES AND THEY WERE CLEAR.	
CLEANED TRAP AND MADE SURE IT WAS FLOWING	
CORRECTLY. FOUND NOTHING WRONG WITH WATER TRAF	P
AT ALL. NOTE: NEXT STEP IS TO CHANGE AMOT T-STAT	
OUT. ITS APPARENT THE WATER TEMP FLOWING THROUGH	SH
AFTERCOOLER CORE; BELOW 90 DEGREES	
CAUSING THIS PROBLEM. WILL ORDER	
PARTS AND RESCHEDULE. 8/11/06 RETURNED WITH	
PARTS AND SHUT WATER VALES OFF TO AFTERCOOLER.	
DRAINED 5 GAL OUT AND REMOVED OLD STAT AND	
INSTALLED NEW ONE WITH SEALS. RAN ENGINE AND BLED	o
WATER CIRCUIT. NO LEAKS AT THIS TIME.	
WO Total:	1,000.20

1404550	0 00 0005 40-00 444	7040 514	101111 01	0 040	7504				4 400 00 750 HOUR OFFINISE WITH OIL OAMER FOR IT	
1484550	Sep 23, 2005 12:00 AM	7042 EM	194141 - 01	C 042	/534				1,133.00 750 HOUR SERVICE WITH OIL SAMPLE ONLY	
									PERFORMED 750 HOUR LEVEL 2 MAINTENANCE ON UNIT.	
									-CHANGED OIL FILTERS.NO OIL CHANGE PER CUSTOMER -CHANGED AIR FILTER PRE-CLEANERS.	
									-CHANGED AIR FILTER PRE-CLEANERSCHECKED COOLING SYSTEM.	
									-CHECKED LUBE OIL SYSTEM.	
									-CHECKED FUEL SYSTEM.	
									-CHECKED AIR SYSTEM.	
									-CHECKED EXHAUST SYSTEM.	
									-CHECKED STARTING SYSTEM.	
									-CHECKED BATTERIES AND CLEANED AS NEEDED.	
									-CHECKED ENGINE MONITORS AND SAFETY CONTROLS.	
									-CHECKED CONTROL PANEL.	
									-ADJUSTED VALVES AND BRIDGES.	
									-PERFORMED EXHAUST VALVE TAKE UP MEASUREMENT.	
									-PERFORMED CYLINDER COMPRESSION TEST IF REQUIRED.	
									-GREASED GENERATOR BEARING.	
									-CLEANED AND REGAPPED SPARK PLUGS.	
									-GREASED CARBURETOR LINKAGE.	
									-RAN ENGINE AND CHECKED FOR PROPER OPERATION.	
									-TOOK OIL, AFTERCOOLER COOLANT AND JACKET WATER	
									COOLANT SAMPLES.	
									-REPLACED TWO SPARK PLUGS	
									-REPLACED ALL TRANSFORMERS SEALS AND GASKETS	
									TRANSFORMERS WERE LEAKING OIL	
		7005 51			 .			WO Total:		1,133.00
1484550	Aug 27, 2004 12:00 AM	7025 EM	187857 - 01	C 042	7534				1,067.00 ANNUAL LEVEL 2-750 HOUR SERVICE WITH OIL SAMPLE ON	
									LY	
									PERFORMED 750 HOUR LEVEL 2 MAINTENANCE ON UNIT.	

									-CHANGED OIL FILTERS.NO OIL CHANGE THIS YEAR.	
	B								-CHANGED AIR FILTER PRE-CLEANERS.	
	W.								-CHECKED COOLING SYSTEM.	
									-CHECKED LUBE OIL SYSTEM.	
									-CHECKED AIR SYSTEM.	
									-CHECKED EXHAUST SYSTEM.	
									-CHECKED STARTING SYSTEM.	
									-CHECKED BATTERIES AND CLEANED AS NEEDED.	
									-CHECKED ENGINE MONITORS AND SAFETY CONTROLS.	
									-CHECKED CONTROL PANEL.	
									-PERFORMED CYLINDER COMPRESSION TEST IF REQUIRED.	
									-GREASED GENERATOR BEARING.	
									-CLEANED AND REGAPPED SPARK PLUGS.	
									-GREASED CARBURETOR LINKAGE.	
									-RAN ENGINE AND CHECKED FOR PROPER OPERATION.	
								WO Total:		1,067.00
1484550	Mar 29, 1996 12:00 AM	6494 EN	/40066 - 02	C 016	1554	EW00470	EW00470	EW00470	818.88 PERFORMED PI3839 - BOTTOM END TRANSFORMER UPDATE	
									AS REQUIRED.	
1404550	Eob 16, 1006 10:00 AM	6400	120552 04	0 040	1554	EW/00470	EW/00470	WO Total:	400 24 INICTALL IN LINE COADLY DILLIO EU TEDO AND MENAMBINO	818.88
1484550	Feb 16, 1996 12:00 AM	6108 EN	//39553 - 01	C 016	1004	EW00470	EW00470	EW00470	488.24 INSTALL IN-LINE SPARK PLUG FILTERS AND NEW WIRING HARNESS PER CATERPILLAR. LOUIS TO PAY OT.	
									PERFORMED PI3838 PRIMARY IGNITION FILTER UPDATE.	
								WO Total:	LES STATES FROM THAT TOTAL OF THE LET COLDATE.	488.24
								TTO TOTAL.		400.24