



Customer: FUELLED Description: GLYCOL REBOILER

Facility: N/A Location: OVINTIV STORAGE YARD

Reg A#: UNABLE TO LOCATE DATA PLATE Serial #: \_\_\_\_\_ Drawing#: 5

CRN #: \_\_\_\_\_ Manufacturer: \_\_\_\_\_ Unit #: \_\_\_\_\_ Year Built: \_\_\_\_\_

Shell MAWP: \_\_\_\_\_ Shell MAWT: \_\_\_\_\_ Shell Material: \_\_\_\_\_ Nominal: \_\_\_\_\_ CA: \_\_\_\_\_


Tube "A" MAWP: \_\_\_\_\_ Tube "A" MAWT: \_\_\_\_\_ Head Material: \_\_\_\_\_ Nominal: \_\_\_\_\_ CA: \_\_\_\_\_

Tube "B" MAWP: \_\_\_\_\_ Tube "B" MAWT: \_\_\_\_\_ Tube Material: \_\_\_\_\_ Nominal: \_\_\_\_\_ CA: \_\_\_\_\_

Size: \_\_\_\_\_ Manway: \_\_\_\_\_ MDMT: \_\_\_\_\_ Boot Shell Mat: \_\_\_\_\_ Nominal: \_\_\_\_\_ CA: \_\_\_\_\_

Insulated: \_\_\_\_\_ C Stamp: \_\_\_\_\_ RT: \_\_\_\_\_ PWHT: \_\_\_\_\_ Boot Head Mat: \_\_\_\_\_ Nominal: \_\_\_\_\_ CA: \_\_\_\_\_

OCT. 2024\_PIPING NOT INSTALLED AT TIME OF INSPECTION.

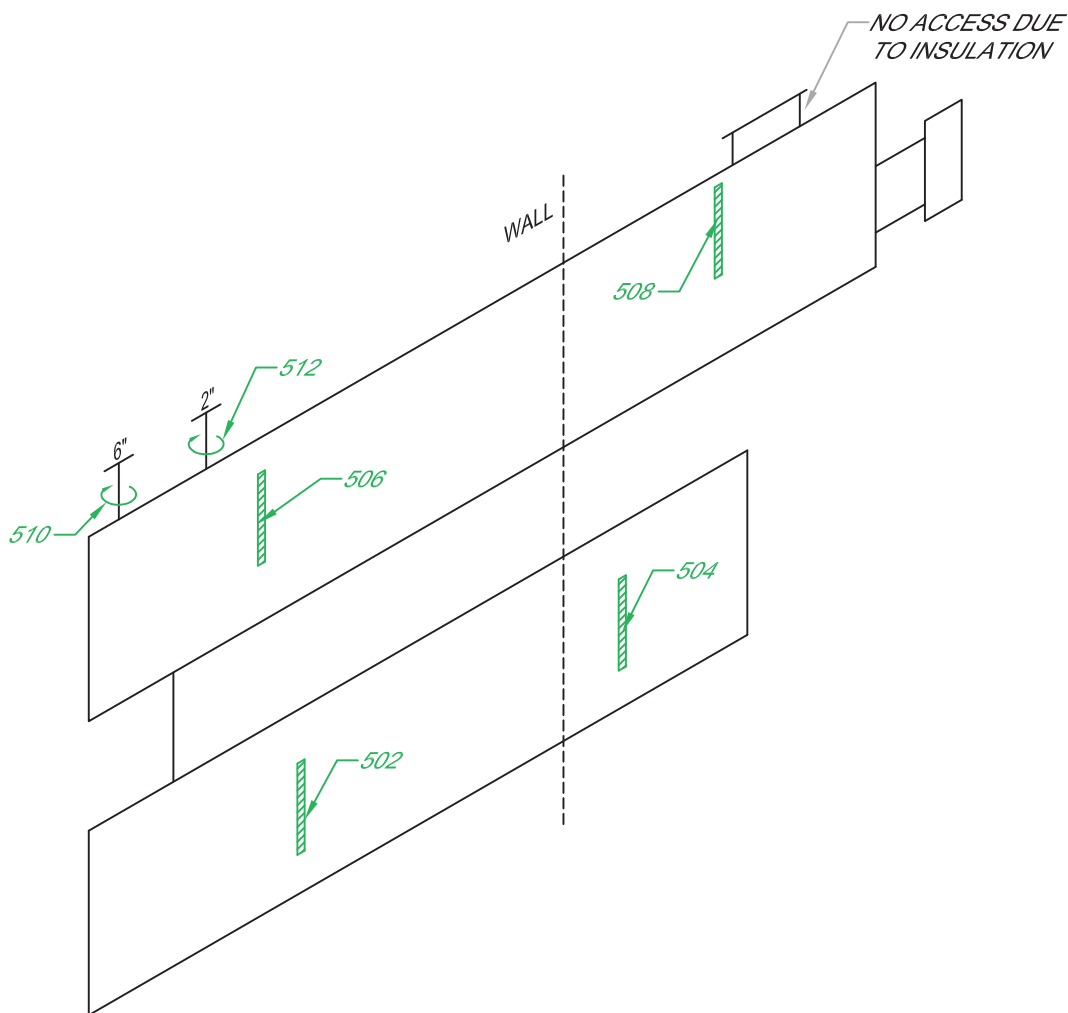



## UTS Data Sheet

Client: **Fuelled**

Facility: **n/a**

LSD: **Ovintiv Storage Yard**

Equip Description: **Glycol Reboiler**

Reg A #: **no data plate**

Drawing #: **5**

	Nominal Thickness (mm)	Corrosion Allowance (mm)	Flag Thickness (mm)
<b>502</b>			
Description: <b>Mid Shell</b>			7.1
Date: Oct. 29, 24			
Minimum: 8.6			
Average: 8.8			
Comments:			
<b>504</b>			
Description: <b>Mid Shell</b>			6.5
Date: Oct. 29, 24			
Minimum: 8.0			
Average: 8.3			
Comments:			
<b>506</b>			
Description: <b>Upper Shell</b>			6.8
Date: Oct. 29, 24			
Minimum: 8.3			
Average: 8.7			
Comments:			
<b>508</b>			
Description: <b>Upper Shell</b>			7.2
Date: Oct. 29, 24			
Minimum: 8.7			
Average: 8.9			
Comments:			
<b>510</b>			
Description: <b>Circ on 6" Nozzle</b>	7.1		5.6
Date: Oct. 29, 24			
Minimum: 6.7			
Average: 7.1			
Comments:			
<b>512</b>			
Description: <b>Circ on 2" Nozzle</b>	5.5		4.0
Date: Oct. 29, 24			
Minimum: 4.9			
Average: 5.3			
Comments:			

**no data plate**  
Glycol Reboiler



**no data plate**  
Glycol Reboiler





**no data plate**  
Glycol Reboiler

