

Bay 5, 240040 Frontier Place SE
Rocky View, Alberta T1X 0N2



REPORT: UWG-150326-1
DATE: MAR.26,2015
PAGE: 1 OF 3

ULTRASONIC EXAMINATION REPORT

CLIENT:	HUSKY	CONTRACTOR:	
LOCATION NAME:	ANSELL	STREAMLINE JOB#	15-081
LOCATION:	7-27-51-19 W5M	CLIENT PO#:	
ITEMS EXAMINED:	SLUG CATCHER A0436162 SAP 66005383		
PROCEDURE:	UT-1	ACCEPTANCE CRITERIA:	CLIENT SPEC'S
		SPECIFICATION:	ASME V ART. 5

EQUIPMENT

EQUIPMENT TYPE:	DMS / USM GO	Serial #:	12126481	Cal Date:	DEC.30,2015	Cable Length/Type:	60" / Lemo to Microdot	COUPLANT:	UT-X
-----------------	--------------	-----------	----------	-----------	-------------	--------------------	------------------------	-----------	------

CALIBRATION BLOCKS:	1.000" C/S Step SN 044312	UT INSPECTION MODE:
---------------------	---------------------------	---------------------

REFERENCE REFLECTOR:	Type:	Size:	Depth:	Signal Respose Height: 80%	<input checked="" type="checkbox"/> ZERO DEGREE <input type="checkbox"/> SHEARWAVE
----------------------	-------	-------	--------	----------------------------	--

PROBE TYPE	ANGLE	WAVE	FREQ.	SIZE	MANUF.	SERIAL #	RANGE	REF. LEVEL (Db)	SCAN LEVEL (Db)
DUAL	0	LONG	5MHz	0.250"	GE	026L82	1.000"	64	70

SURFACE CONDITION:	<input checked="" type="checkbox"/> CLEAN BASE METAL <input type="checkbox"/> AS GROUND <input type="checkbox"/> WIRE WHEEL BUFFED <input type="checkbox"/> AS WELDED <input type="checkbox"/> PAINTED <input type="checkbox"/> SAND BLAST <input type="checkbox"/> Other:	Material: C/S
--------------------	--	---------------

EXAMINATION DETAILS AND RESULTS

A ZERO DEGREE UT INSPECTION WAS PERFORMED ON THE 3" INLETS AND 2" CONDENSATE LINES OFF THE SLUG CATCHER
AS REQUESTED BY THE CLIENT.

RESULTS:

SEE PG-2 FOR READINGS, DESCRIPTIONS AND COMMENTS. READINGS ARE TO BE FURTHER REVIEWED BY THE CLIENT.

TECHNICIAN/CERTIFICATION:	WARREN GILL CGSB UT 1,MT II #17778	CLIENT:	GREG GUENETTE
SIGNATURE:		CHARGES REF.	APPROVAL:
ASSISTANT:	JAROD SMITH	JOB#	
		15-081	

Bay 5, 240040 Frontier Place SE
Rocky View, Alberta T1X 0N2



REPORT: UWG-150326-1
DATE: MAR.26,2015
PAGE: 2 OF 3

ULTRASONIC EXAMINATION REPORT


CLIENT:	HUSKY	CONTRACTOR:	
LOCATION NAME:	ANSELL	STREAMLINE JOB#	15-081
LOCATION:	7-27-51-19 W5M	CLIENT PO#:	
ITEMS EXAMINED:	SLUG CATCHER A0436162 SAP 66005383		

EXAMINATION DETAILS AND RESULTS



3.5 " ELBOW
NOMINAL 0.216"
LOW 0.227"
AVG. 0.238"

3.5" ELBOW
NOMINAL 0.216"
LOW 0.188"
AVG. 0.213
EROSION NOTED

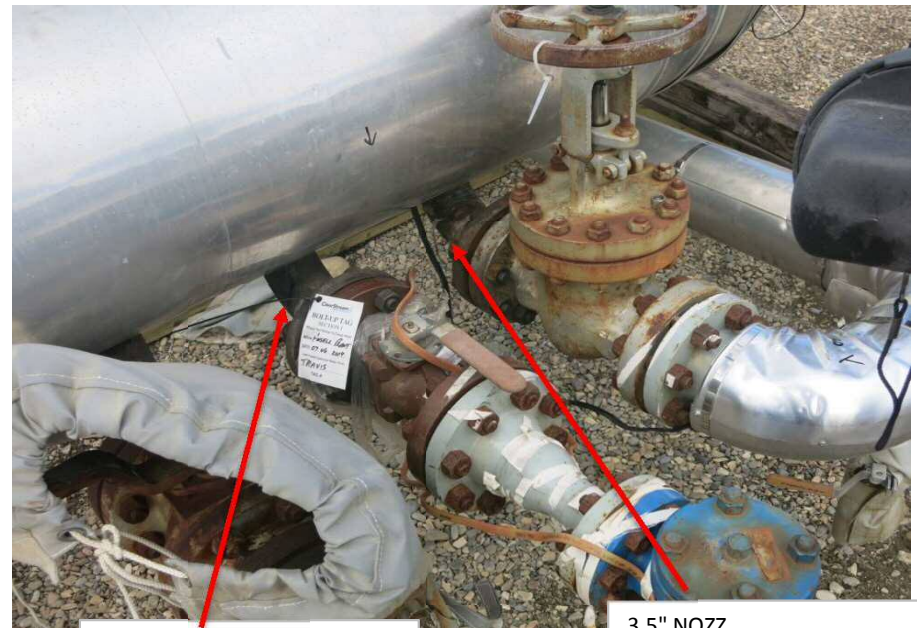

3.5" NOZZ.
ASSMD. NOMINAL 0.216"
LOW 0.196"
AVG. 0.210"

3.5" NOZZ.
ASSMD. NOMINAL 0.216"
LOW 0.177"
AVG. 0.202"
EROSION NOTED

Bay 5, 240040 Frontier Place SE
Rocky View, Alberta T1X 0N2



REPORT: UWG-150326-1

DATE: MAR.26,2015

PAGE: 3 OF 3

ULTRASONIC EXAMINATION REPORT

CLIENT:	HUSKY	CONTRACTOR:	
LOCATION NAME:	ANSELL	STREAMLINE JOB#	15-081
LOCATION:	7-27-51-19 W5M	CLIENT PO#:	
ITEMS EXAMINED:	SLUG CATCHER A0436162 SAP 66005383		

EXAMINATION DETAILS AND RESULTS

