



Location: 141/161C-49-27 v3m Tank Type: Production Date: 5 Aug-18
Mfg: Universal Year blt: 2011 S/N: 022413-1 CAP: 1000 bbl
Floor Thk: 1/4 Shell Thk: 1/4 x 3/16 Roof Thk: 3/16
Requisitioned by: Dave Miller Approver: Martin Cole Approver Code: 22-0149311
WO #: 81300610 PO#: 8401273069 CC: SAP #: 66175964

INTERNAL INSPECTION:

ID	Item	Yes	Good	N/A	See Notes
	GENERAL				
T1	Other (Please Explain)				
T2	Corrosion				
T3	Erosion				
T4	Distortion				
T5	Blisters				
T6	Deposits				
T7	Welds				
T8	Nozzles				
T9	Shell				
T10	Roof				
T11	Floor				
	GENERAL				
T21	Other - Firetube				
T21	Other - Anodes				
T22	Annular Ring				
T23	Sump				
T24	Roof Supports				
T25	Thermowells				
T26	Metallic Linings				
T27	Non Metallic Linings				
T28	Internal Steam Coil / other Piping				
T29	Level Gauge				
T30	Other Welded Attachements				
	Backwelding Req'd				


[illegible]

Without MFE		
.170 - up	5 yr	☒
.160 - .169	4 yr	
.150 - .159	3 yr	
.140 - .149	2 yr	
.130 - .139	1 yr	
under .130	Patch	
	Replace	
	Floor	
	Shell	

S/N: 022413-1

Location: 141/11-16-49-2703m

With MFE		
.140 - .150	5 yr	
.130 - .139	4 yr	
.120 - .129	3 yr	
.110 - .119	2 yr	
.100 - .109	1 yr	
under .100	Patch	
	Replace	
	Floor	
	Shell	

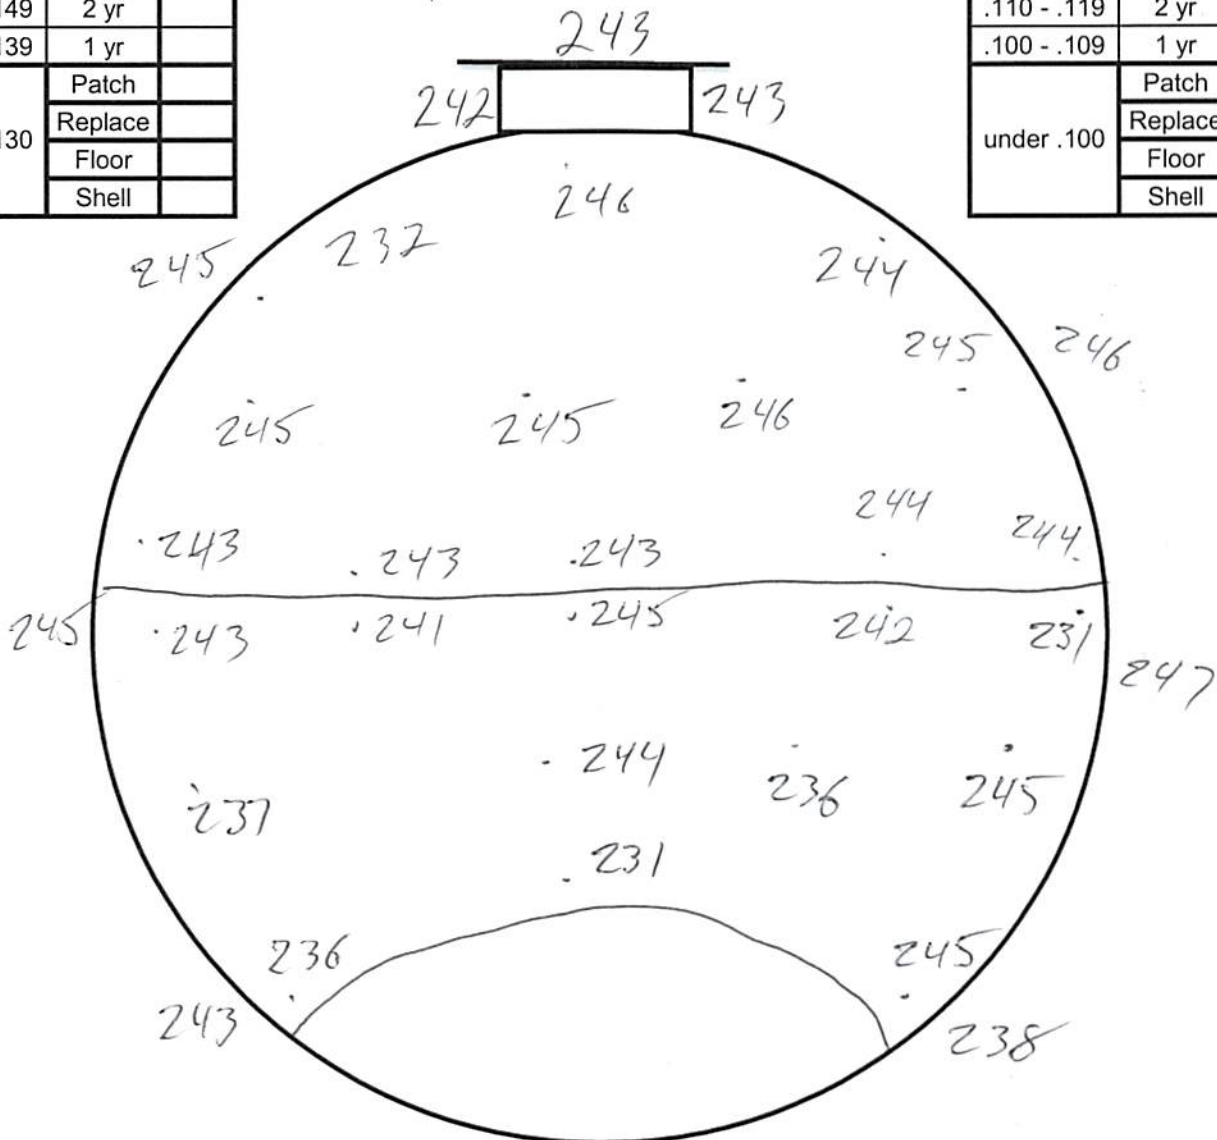

Comments:

- Lift and rebase Tank.

Inspected by:

Trista Sommer

Date:

5-Aug-19

Husky Inspector:


Date:

Type of Inspection: UT/Vis	Rev: N/A	Client: HUSKY OIL OPERATIONS	Date: 05-Aug-18
Test Technique: O deg Thickness		IRISNDT #: LYN1801188	WO #: 81300610
Equipment: DMS 2 FH2E Probe		Location: 141/ 11-16-49-27W3M	PO #: 8401273069
Code / Standard: Client Information		Item Inspected: Production Tank	Appr# 2Z-0149311

Inspection Results: Appr: Martin Code

Requisitioner: Dave Miller

A Visual and UT Examination was carried out on the following 1000 BBL Oil tank for the purpose of continued fitness for service and inspection interval determination: See field report for UT readings and inspection interval

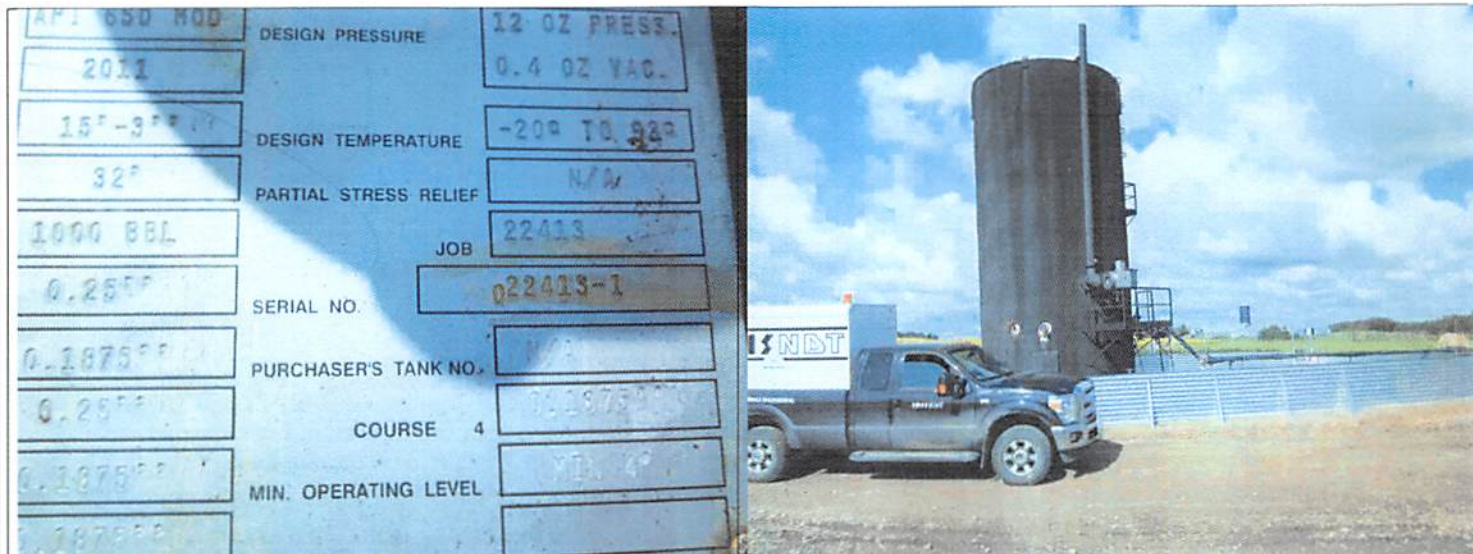

Recommendations:

Lift and Rebase tank due to 4" of settlement to the south

Note Spot UT carried out on the floor and shell as a spot check for overall condition of the floor integrity and is not a 100% scan method

Inspection Limitation(s): 1st course access only,

Unit#: 1039	Kilometers: 0	Consumables:	Interpretation by:
In: _____ Out: _____ Hrs: _____		min	Tristan Sommerfeld
In: _____ Out: _____ Hrs: _____			(Print) <i>Tristan Sommerfeld</i>
Personnel:			(Sign) <i>Tristan Sommerfeld</i>
Tristan Sommerfeld			SNT-TC-1A: N/A
Jordan Ross			API-653 (Level)
			CERT #: 38910
			Client Representative:
			(Print) Samantha Voros
			(Sign) <i>Samantha Voros</i>
			I am in full agreement with report contents