

Equipment #: 66155548
Area: SW Marsden
Cost Centre: 25551



Tank Inspection Report


Approver: _____ Approver #: _____ WO#: _____
Requisitioned By: Kim BERTOLA Location: A13-14-46-25W3 PO# _____
Manufacturer: WILCO Serial #: 016040-10 Tank Type: PROD
Capacity: 1600 BBL Thickness: Floor 1/4" Shell 1/4 + 3/16 Year Built: 2008

External Inspection

T61	Insulation	<u>GOOD</u>	FAIR	POOR	
T64	Cladding	<u>GOOD</u>	FAIR	POOR	<u>nla</u>
T32	Base / Landscaping	<u>GOOD</u>	<u>FAIR</u>	POOR	<u>on timbers</u>
T14	Liner / Containment	<u>GOOD</u>	FAIR	POOR	<u>containment ring is partially disassembled</u>
T8	Ground Cable		<u>YES</u>	<u>NO</u>	
T6	Ladder/ Stairway	<u>GOOD</u>	<u>FAIR</u>	POOR	
T7	Platform	<u>GOOD</u>	<u>FAIR</u>	POOR	
T41	Piping Alignment	<u>GOOD</u>	FAIR	<u>POOR</u>	<u>flowline leaning</u>
T15	Shell	<u>GOOD</u>	<u>FAIR</u>	POOR	
T44	Envirovault		<u>YES</u>	<u>NO</u>	<u>only welded around</u>
T16	Roof	<u>GOOD</u>	<u>FAIR</u>	POOR	
T11	Paint	<u>GOOD</u>	FAIR	POOR	

Internal Inspection

T11	Floor	<u>GOOD</u>	FAIR	POOR	
V9	Shell	<u>GOOD</u>	FAIR	POOR	
V10	Roof	<u>GOOD</u>	<u>FAIR</u>	POOR	
V28	Firetube	<u>GOOD</u>	<u>FAIR</u>	POOR	INTERNAL: <u>GOOD</u> BOWED OVALLED FLANGE LEAKING: <u>YES</u> <u>NO</u> <u>debris in firetube</u>
V8	Nozzles	<u>GOOD</u>	<u>FAIR</u>	POOR	<u>Sch 40 sting nozzle on shell, 3" riser</u>
V7	Welds	<u>GOOD</u>	<u>FAIR</u>	POOR	BACKWELDING REQ'D: <u>YES</u> <u>NO</u> <u>not braced to shell</u>
V21	Anodes	<u>GOOD</u>	FAIR	POOR	<u>nla</u>
V27	Coating	<u>GOOD</u>	FAIR	POOR	TYPE: <u>nla</u>

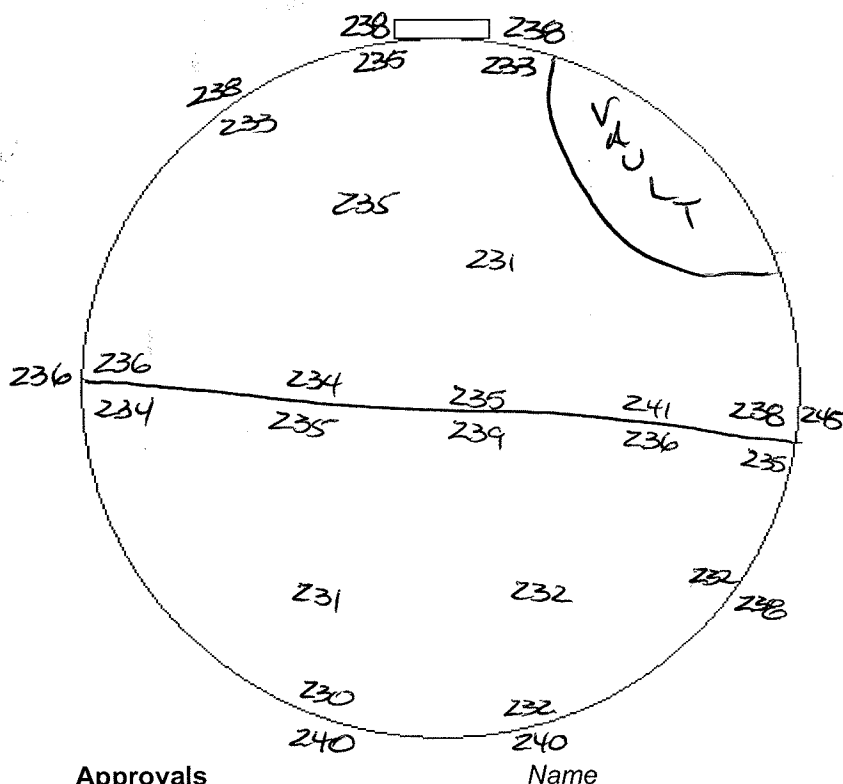

Notes & Summary of Recommendations:

- straighten flowline if tank is staying on-site
- blow out firetube
- brace 3" riser to shell
- upgrade sting nozzle ~~to~~ Sch 160

Inspection
Interval: 5 yr

Entered in RBMI: ☐

Signature

Date

Approvals

Inspector
Husky Inspector

Name
Marie Whitman

M Whitman

2013-09-12